
F VR38ZN S14

Codice articolo: **813409006 / ?????**

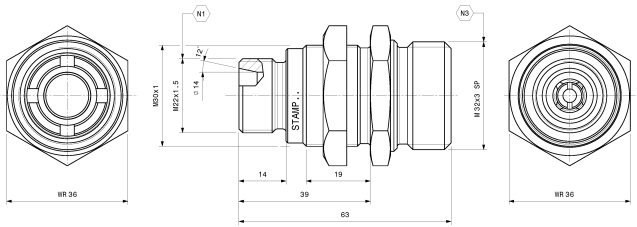

??????? ?????????? ? ??????? ?????? ??? ???????	**?????? ??????????** 3/8"
?????????? Nitrile NBR	**?????????** Zn-Ni
?????????????????? ? ???????????? ??????? ("Rohrleitung")	**??????? ??????????** ????
??????? ???????????? ?????????	**????????** ????????????? ???????????? ?????
???????? ?????????? ???? ??? ??????????	**???????????? ??? ?????????** ???
P????? MALE THREAD METRIC S - 24° CONE (ISO 8434-1 & DIN 2353)	**?????????? ? ?????????? ?????????** ???????? ? ????? ???????
??????????? -20 / +100 °C; -4 / +212 °F	**??????? ??????????** ???????? ???????????? ??? ???????????? ???????, ????????, ??????????? ??????, ???????????? ??????, ??????????-???????????? ??????, ???????? ????????????? , ????????????? ??????????, ????????????, ????????? ? ???????????? ????????

?????????????????	IMPERIAL
ISO DN (mm)	10
???????????? ?????? (???/???)	12.19
???????????? ??????? ???????? - ?????????? (psi)	5800
??????? ???????? - ???????????? (????/??. ????)	5800
???????? ??????? - ????????? (????/??. ????)	23200
???????? ??????? - ???????????? (????/??. ????)	14500
?????? (??)	0.01
?????? ??????? ??????? ??? ?????????? (????-???)	1.474
?????? ??????? ??????? ??? ????????????? (????-???)	1.3266

??????	IMPERIAL
?????? ??????? (A)	M22x1.5
????? ????? ?+? (????)	4,47
????? (????)	2,48
???????????? ??????? (????)	1,63
??? (????)	0,54

????????????? ???????

??? ????????	**Tipologia**	**???????????? ????????**
813409007	Maschio	M VR38ZN S14

Spare kits

??? ????????	**???????????? ????????**
815700902	SPARE KIT OR NBR+BK F VR38

Caps

??? ????????	**???????????? ????????**
814900012	PLASTIC CAP F VR38 RED

STUCCHI Quick Couplings Catalog - April 2021 - All right reserved.
Via della Lira Italiana, 397 24040 - Pagazzano (BG) Italy - Contact us
Texts, data and illustrations mentioned in this catalogue may be changed by Stucchi at any time, without notice; always refer to the version uploaded on the English version of stucchigroup.com/en website for the latest release. In case of doubt, please contact Stucchi technical service