
F VD38 S12*

Codice articolo: **809509030** / **?????** / ***Prodotto disponibile su richiesta**

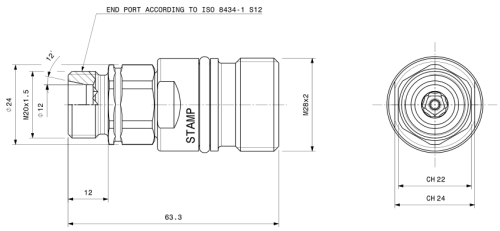

??????? ?????????? ?????? (POPPET)	**?????? ??????????** 3/8"
?????????? Nitrile NBR	**?????????** Cr3
???????????????????? ISO 14541	**??????? ??????????** ????
??????? ???????????? ?????????	**????????** ????????????? ???????????? ?????
???????? ?????????? ???? ??? ??????????	**???????????? ??? ?????????** ???
P????? MALE THREAD METRIC S - 24° CONE (ISO 8434-1 & DIN 2353)	**?????????? ? ?????????? ?????????** ???????? ? ????? ???????
??????????? -20 / +100 °C; -4 / +212 °F	**??????? ??????????** ???????? ???????????? ??? ???????????? ???????, ????????, ??????????? ??????, ???????????? ??????, ??????????-???????????? ??????, ???????? ????????????? , ????????????? ?????????, ????????????, ????????? ? ???????????? ????????

?????????????????	IMPERIAL
ISO DN (mm)	10
???????????? ?????? (???/???)	12.19
???????????? ??????? ???????? - ?????????? (psi)	6525
??????? ???????? - ???????????? (????/??. ????)	6525
???????? ??????? - ????????? (????/??. ????)	20300
???????? ??????? - ???????????? (????/??. ????)	20300
?????? (??)	1
?????? ??????? ??????? ??? ?????????? (????-???)	0.737
?????? ??????? ??????? ??? ????????????? (????-???)	0.3685

??????	IMPERIAL
?????? ??????? (A)	M20X1.5
????? ????? ?+? (????)	3,82
????? (????)	2,49
???????????? ??????? (????)	0,94
??? (????)	0,31

????????????? ???????

??? ????????	**Tipologia**	**???????????? ????????**
809509031	Maschio	M VD38 S12

Spare kits

??? ????????	**???????????? ????????**
815701151	SPARE KIT OR NBR+BK+EXT F VD38

Caps

??? ????????	**???????????? ????????**
814900002	PLASTIC CAP F VD38 RED

STUCCHI Quick Couplings Catalog - April 2021 - All right reserved.
Via della Lira Italiana, 397 24040 - Pagazzano (BG) Italy - Contact us
Texts, data and illustrations mentioned in this catalogue may be changed by Stucchi at any time, without notice; always refer to the version uploaded on the English version of stucchigroup.com/en website for the latest release. In case of doubt, please contact Stucchi technical service