
F VD100 L18 SCHOTT 32

Codice articolo: **809510030 / ?????**

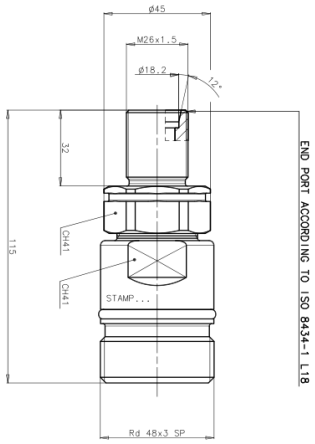

??????? ?????????? ?????? (POPPET)	**?????? ??????????** 1"
?????????? Nitrile NBR	**?????????** Cr3
?????????????????? ISO 14541	**??????? ??????????** ????
??????? ???????????? ?????????	**????????** ????????????? ???????????? ?????
???????? ?????????? ???? ??? ??????????	**???????????? ??? ?????????** ???
P????? MALE THREAD METRIC L SCHOTT - 24° CONE BULKHEAD (ISO 8434-1 & DIN 2353)	**?????????? ? ?????????? ?????????** ???????? ? ????? ???????
??????????? -20 / +100 °C; -4 / +212 °F	**??????? ??????????** ???????? ???????????? ??? ???????????? ???????, ????????, ??????????? ??????, ???????????? ??????, ??????????-???????????? ??????, ???????? ????????????? , ????????????? ??????????, ?????????????, ????????? ? ???????????? ????????

??????????????????	IMPERIAL
???????????? ?????? (???/???)	5.3
???????????? ??????? ???????? - ?????????? (psi)	4350
??????? ???????? - ???????????? (????/??. ????)	4350
???????? ???????? - ????????? (????/??. ????)	14500
???????? ???????? - ???????????? (????/??. ????)	14500
?????? (??)	14
?????? ??????? ??????? ??? ?????????? (????-???)	1.9899
?????? ??????? ??????? ??? ????????????? (????-???)	1.6214

??????	IMPERIAL
?????? ??????? (A)	M26x1.5
????? ????? ?+? (????)	7,04
????? (????)	4,53
???????????? ??????? (????)	1,88
??? (????)	1,63

????????????? ???????

??? ????????	**Tipologia**	**???????????? ????????**
809510031	Maschio	M VD100 L18 SCHOTT 32

Spare kits

??? ????????	**???????????? ????????**
815700908	SPARE KIT OR NBR+BK+EXT F VD100

Caps

??? ????????	**???????????? ????????**
814900016	PLASTIC CAP F VD100 RED

STUCCHI Quick Couplings Catalog - April 2021 - All right reserved.
Via della Lira Italiana, 397 24040 - Pagazzano (BG) Italy - Contact us
Texts, data and illustrations mentioned in this catalogue may be changed by Stucchi at any time, without notice; always refer to the version uploaded on the English version of stucchigroup.com/en website for the latest release. In case of doubt, please contact Stucchi technical service