
M/COUPLER VOF100 BSP

Codice articolo: **811200001** / **Coupler**

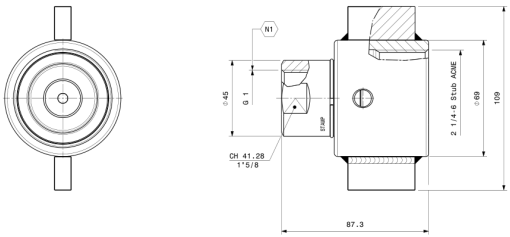

??????? ?????????? ?????? (POPPET)	**?????? ??????????** 1"
?????????? Nitrile NBR	**?????????** Cr3
?????????????????? ? ???????????? ??????? (????? ? ????)	**??????? ??????????** ????
??????? ???????????? ?????????	**????????** ????????????? ???????????? ?????
???????? ?????????? ???? ??? ??????????	**???????????? ??? ?????????** ???
P????? FEMALE THREAD BSPP (ISO 1179-1)	**?????????? ? ?????????? ?????????** ???????? ? ????? ???????
??????????? -20 / +100 °C; -4 / +212 °F	**??????? ??????????** ???????? ???????????? ??? ???????????? ???????, ????????, ??????? ?????????, ????????? ?????????, ??????????? ??????, ???????????? ??????, ??????????-???????????? ??????, ???????? ????????????? , ?????????????, ????? ? ???

??????????????????	IMPERIAL
ISO DN (mm)	25
???????????? ?????? (???/???)	100.17
???????????? ??????? ???????? - ?????????? (psi)	5002.5
??????? ???????? - ???????????? (????/??. ????)	5002.5
???????? ??????? - ????????? (????/??. ????)	19995.5
???????? ??????? - ???????????? (????/??. ????)	19995.5
?????? (??)	21.2
?????? ??????? ??????? ??? ?????????? (????-???)	1.1792
?????? ??????? ??????? ??? ????????????? (????-???)	0.8107

??????	IMPERIAL
?????? ??????? (A)	1"
????? ????? ?+? (????)	6,02
????? (????)	3,44
???????????? ??????? (????)	4,29
??? (????)	2,82

????????????? ???????

??? ????????	**Tipologia**	**???????????? ????????**
811200001	Coupler	M/COUPLER VOF100 BSP

Spare kits

??? ????????	**???????????? ????????**
815700959	SPARE KIT INTERNAL PARTS F-M VOF100

Caps

??? ????????	**???????????? ????????**
815405011	ALUMINUM CAP P VOF100 NATURAL

STUCCHI Quick Couplings Catalog - April 2021 - All right reserved.
Via della Lira Italiana, 397 24040 - Pagazzano (BG) Italy - Contact us
Texts, data and illustrations mentioned in this catalogue may be changed by Stucchi at any time, without notice; always refer to the version uploaded on the English version of stucchigroup.com/en website for the latest release. In case of doubt, please contact Stucchi technical service