
M/COUPLER VOF34 BSP

Codice articolo: **811200003** / **Coupler**

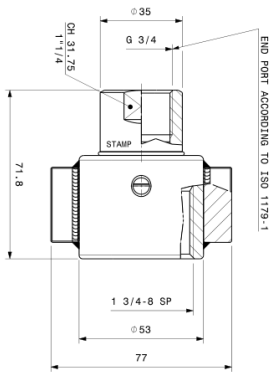

??????? ?????????? ?????? (POPPET)	**?????? ??????????** 3/4"
?????????? Nitrile NBR	**?????????** Cr3
?????????????????? ? ???????????? ??????? (????? ? ????)	**??????? ??????????** ????
??????? ???????????? ?????????	**????????** ????????????? ???????????? ?????
???????? ?????????? ???? ??? ??????????	**???????????? ??? ?????????** ???
P????? FEMALE THREAD BSPP (ISO 1179-1)	**?????????? ? ?????????? ?????????** ???????? ? ????? ???????
??????????? -20 / +100 °C; -4 / +212 °F	**??????? ??????????** ???????? ???????????? ??? ???????????? ???????, ????????, ??????? ?????????, ????????? ?????????, ??????????? ??????, ???????????? ??????, ??????????-???????????? ??????, ???????? ????????????? , ?????????????, ????? ? ???

??????????????????	IMPERIAL
ISO DN (mm)	20
???????????? ?????? (???/???)	56.18
???????????? ??????? ???????? - ?????????? (psi)	5002.5
??????? ???????? - ???????????? (????/??. ????)	5002.5
???????? ??????? - ????????? (????/??. ????)	19995.5
???????? ??????? - ???????????? (????/??. ????)	19995.5
?????? (??)	11.5
?????? ??????? ??????? ??? ?????????? (????-???)	0.8844
?????? ??????? ??????? ??? ????????????? (????-???)	0.4422

??????	IMPERIAL
?????? ??????? (A)	3/4"
????? ????? ?+? (????)	4,87
????? (????)	2,83
???????????? ??????? (????)	3,03
??? (????)	1,38

????????????? ???????

??? ????????	Tipologia	???????????? ????????
811200003	Coupler	M/COUPLER VOF34 BSP

Spare kits

??? ????????	???????????? ????????
815700957	SPARE KIT INTERNAL PARTS F-M VOF34

Caps

??? ????????	???????????? ????????
815405013	ALUMINUM CAP P VOF34 NATURAL

STUCCHI Quick Couplings Catalog - April 2021 - All right reserved.
Via della Lira Italiana, 397 24040 - Pagazzano (BG) Italy - Contact us
Texts, data and illustrations mentioned in this catalogue may be changed by Stucchi at any time, without notice; always refer to the version uploaded on the English version of stucchigroup.com/en website for the latest release. In case of doubt, please contact Stucchi technical service