


F/NIPPLE VOFX200 BSP

Codice articolo: **811200058 / Nipple**

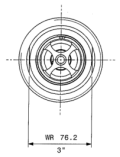

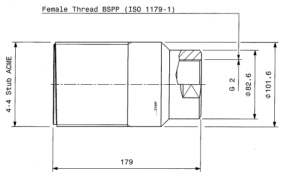

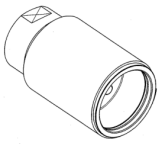

??????? ??????????? ?????? (POPPET)	**?????? ???????????** 2"
??????????? Nitrile NBR	**??????????????????** ? ???????????? ??????? (????? ? ????)
??????? ??????????? ????	**??????? ????????????** ?????????
???????? ??????????? ????? (AISI 316L)	**???????? ???????????** ???? ??? ?????????
???????????? ??? ????????? ???	**P?????** FEMALE THREAD BSPP (ISO 1179-1)
?????????? ? ?????????? ????????? ???????? ? ????? ???????	**???????????** -20 / +100 °C; -4 / +212 °F
??????? ??????????? ???????? ???????????? ??? ???????????? ???????, ???????, ??????? ?????????, ????????? ??????????, ??????????? ??????, ???????????? ??????, ????????????-???????????? ??????, ???????? ?????????????, ??????? ??????????????, ??????, ?????????????, ????? ? ???	

?????????????????	METRIC
ISO DN (mm)	50
???????????? ?????? (?/???)	1100
???????????? ??????? ???????? - ?????????? (???)	20.7
??????? ???????? - ???????????? (???)	20.7
???????? ??????? - ????????? (???)	82.8
???????? ??????? - ???????????? (???)	41.4
?????? (??)	192
?????? ??????? ??????? ??? ?????????? (??)	10
?????? ??????? ??????? ??? ????????????? (??)	10

??????	METRIC
?????? ??????? (A)	2"
????? ????? ?+? (??)	144,4 255,2
????? (??)	179
???????????? ??????? (??)	101,6

????????????? ???????

??? ????????	Tipologia	???????????? ????????
811200058	Nipple	F/NIPPLE VOFX200 BSP

Spare kits

??? ????????	???????????? ????????
815700964	SPARE KIT OR NBR+BK F VOF200
815701150	SPARE KIT INTERNAL PARTS F-M VOFX200

Caps

??? ????????	???????????? ????????
815405018	ALUMINUM CAP N VOF200 NATURAL

STUCCHI Quick Couplings Catalog - April 2021 - All right reserved.
Via della Lira Italiana, 397 24040 - Pagazzano (BG) Italy - Contact us
Texts, data and illustrations mentioned in this catalogue may be changed by Stucchi at any time, without notice; always refer to the version uploaded on the English version of stucchigroup.com/en website for the latest release. In case of doubt, please contact Stucchi technical service