


M/COUPLER VOFX34 NPT

Codice articolo: **811201051** / **Coupler**

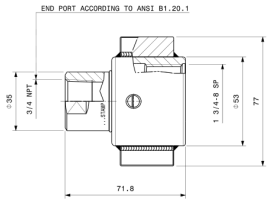

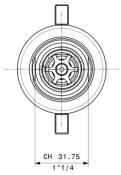

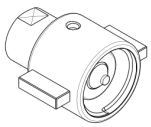

??????? ??????????? ?????? (POPPET)	**?????? ???????????** 3/4"
??????????? Nitrile NBR	**??????????????????** ? ???????????? ??????? (????? ? ????)
??????? ??????????? ????	**??????? ????????????** ?????????
???????? ??????????? ????? (AISI 316L)	**???????? ???????????** ???? ??? ?????????
???????????? ??? ????????? ???	**P?????** FEMALE THREAD NPT (ANSI B.1.20.1)
?????????? ? ?????????? ????????? ???????? ? ????? ???????	**???????????** -20 / +100 °C; -4 / +212 °F
??????? ??????????? ???????? ???????????? ??? ???????????? ???????, ???????, ??????? ?????????, ????????? ??????????, ??????????? ??????, ???????????? ??????, ??????????-???????????? ??????, ???????? ?????????????, ??????? ??????????????, ??????, ?????????????, ????? ? ???	

?????????????????	IMPERIAL
ISO DN (mm)	20
???????????? ?????? (???/???)	56.18
???????????? ??????? ???????? - ?????????? (psi)	3001.5
??????? ???????? - ???????????? (????/??. ????)	3001.5
???????? ??????? - ????????? (????/??. ????)	12006
???????? ??????? - ???????????? (????/??. ????)	9004.5
?????? (??)	11.5
?????? ??????? ??????? ??? ?????????? (????-???)	1.6951
?????? ??????? ??????? ??? ????????????? (????-???)	1.6951

??????	IMPERIAL
?????? ??????? (A)	3/4"
????? ????? ?+? (????)	4,87
????? (????)	2,83
???????????? ??????? (????)	3,03
??? (????)	1,4

????????????? ???????

??? ????????	Tipologia	???????????? ????????
811201051	Coupler	M/COUPLER VOFX34 NPT

Spare kits

??? ????????	???????????? ????????
815701146	SPARE KIT INTERNAL PARTS F-M VOFX34

Caps

??? ????????	???????????? ????????
815405013	ALUMINUM CAP P VOF34 NATURAL

STUCCHI Quick Couplings Catalog - April 2021 - All right reserved.
Via della Lira Italiana, 397 24040 - Pagazzano (BG) Italy - Contact us
Texts, data and illustrations mentioned in this catalogue may be changed by Stucchi at any time, without notice; always refer to the version uploaded on the English version of stucchigroup.com/en website for the latest release. In case of doubt, please contact Stucchi technical service