
F IRC100 BSP

Codice articolo: **812100008 / ?????**

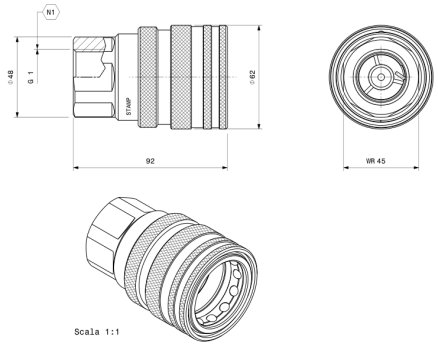

??????? ??????????? ?????? (POPPET)	**?????? ???????????** 1"
?????????? Nitrile NBR	**?????????** Zn-Ni
?????????????????? ? ???????????? ??????? (Nordic)	**??????? ???????????** ????? ???????????? ???????? ? ??????
??????? ???????????? ????? ???????????? ????????	**????????** ????????????? ???????????? ?????
???????? ??????????? ????????????? ??? + ???????????????? ??????	**???????????? ??? ?????????** ???
P????? FEMALE THREAD BSPP (ISO 1179-1)	**?????????? ? ?????????? ?????????** ???
??????????? -20 / +100 °C; -4 / +212 °F	**??????? ???????????** ??????????????????? ???????, ??????????????????? ???????? ???????????? , ???????? ???????????? ??? ???????????? ???????, ????????, ??????????? ??????, ???????????? ??????, ??????????- ???????????? ??????, ???????? ????????????? , ????????????? ?????????, ????????????, ???????? ?????????, ????????? ? ???????????? ????????

?????????????????	METRIC
ISO DN (mm)	25
???????????? ?????? (?/???)	378
???????????? ??????? ???????? - ?????????? (???)	33
??????? ???????? - ???????????? (???)	25
???????? ??????? - ????????? (???)	100
???????? ??????? - ???????????? (???)	100
???? ?????????? (?)	210
???? ???????????? (?)	45
?????? (??)	18

??????	METRIC
?????? ??????? (A)	1"
????? ????? ?+? (??)	113,4
????? (??)	92
???????????? ??????? (??)	62
??? (??)	0,99

????????????? ???????

??? ????????	Tipologia	???????????? ????????
812100009	Maschio	M IRC100 BSP

Spare kits

??? ????????	???????????? ????????
815700708	SPARE KIT OR NBR+BK F IRC100

Caps

??? ????????	???????????? ????????
815000050	PLASTIC CAP F IRC100 RED

STUCCHI Quick Couplings Catalog - April 2021 - All right reserved.
Via della Lira Italiana, 397 24040 - Pagazzano (BG) Italy - Contact us
Texts, data and illustrations mentioned in this catalogue may be changed by Stucchi at any time, without notice; always refer to the version uploaded on the English version of stucchigroup.com/en website for the latest release. In case of doubt, please contact Stucchi technical service